Dimension:
Unit=mm

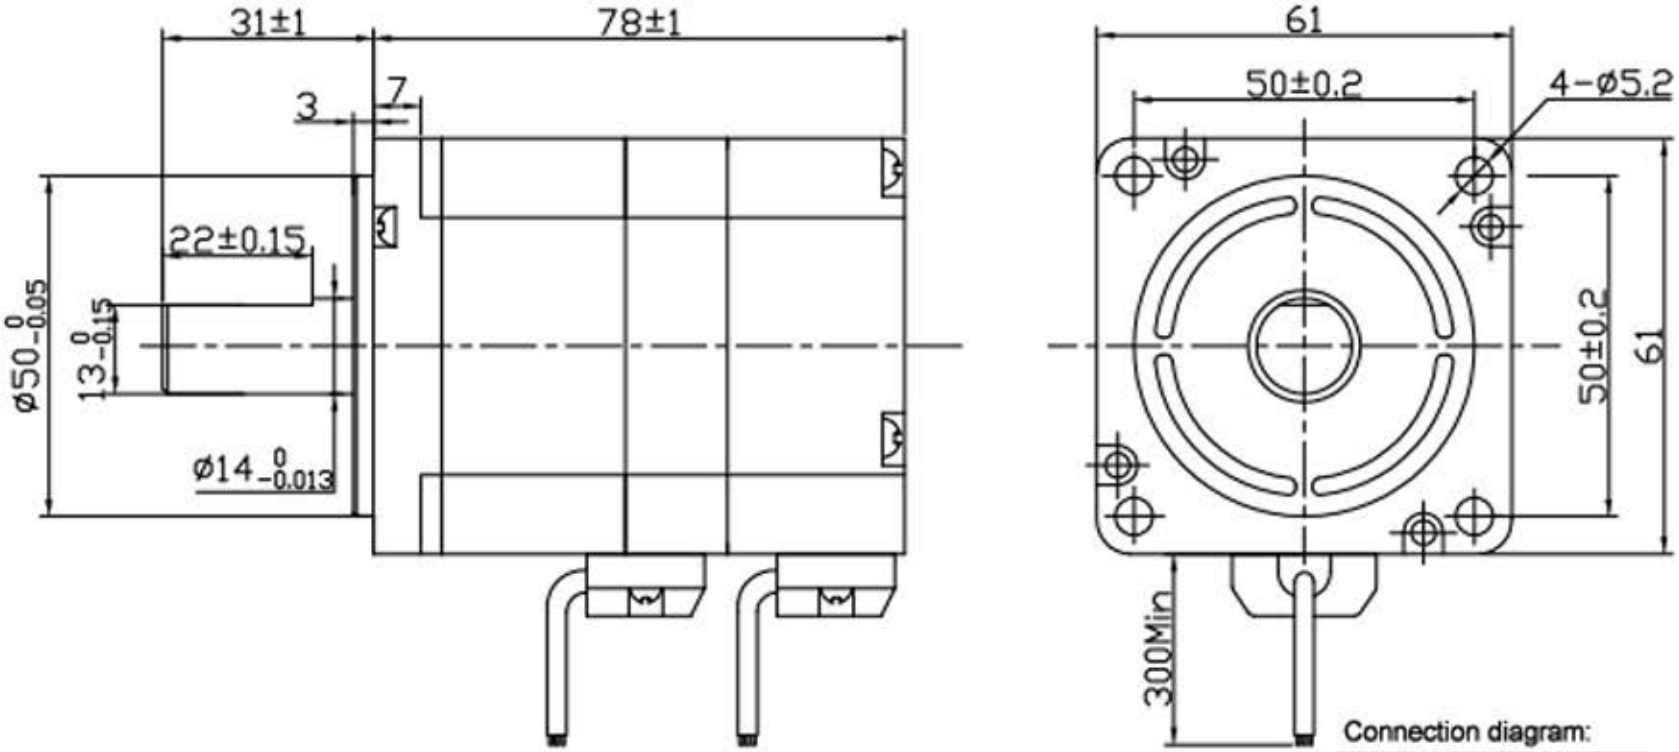

Connection diagram:

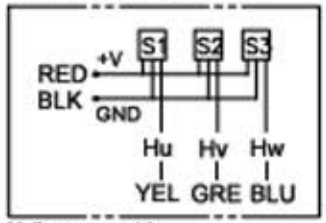

Hall sensor cable
Note: hall sensor power supply voltage +5 to +20VDC

Wiring cable

ROTATION: CW SEE FROM LEAD END

MANUFACTUER MODEL	JK60BLS01
NUMBER OF POLES	8
PHASE TO PHASERESISTANCE	2.31 OHMS
NOMINAL VOLTAGE	48 VDC
NO LOAD SPEED	4000±10% RPM
NO LOAD CURRENT	0.5 Amps Max.
RATED TORQUE	0.32 N-m
RATED SPEED	3000±10% RPM
OUTPUT POWER	100 W
BACK EMF CONSTANT	V/kRPM
TORQUE CONSTANT	N-m/A
INSULATION CLASS	B

ELECTRICAL CONNECTION TABLE			
+5V	RED	红	五芯屏蔽线
HALL U	YEL	黄	
HALL V	GRE	绿	
HALL W	BLU	蓝	
GND	GND	黑	
PHASE U	YEL	黄	三芯电缆线
PHASE V	GRE	绿	
PHASE W	BLU	蓝	

REV.	QTY.	No.		SIG.	DATE	Title: Specification	常州倍士福机电有限公司
DESIGN			STD.			CLS.MAK / WEIGHT / SCALE	BF60BLS01
CHECK							www.besfoc.cn
PROC.			APPR.			PAGE: 1/1	